

NEENAH COLDENHOVE

Heat Transfer Paper

INKJET HEAT TRANSFER PAPER

For commercial use



Produced with: JET-PRO® SS



Produced with: 3G JET OPAQUE®



Produced with: JET-PRO® Active Wear


JET-PRO® Brands

For transfer to all fabrics, mousepads, coasters, puzzles, and leather goods.

JET PRO®SS Heat Transfer Paper is printable by most desktop and roll fed inkjet printers and is very easy to use, providing a soft, supple transferred image on white and light colored fabrics that is vibrant and durable – and will withstand many laundry cycles.

- Image should be printed in **REVERSE**


HEAT
REVERSE/MIRRORED

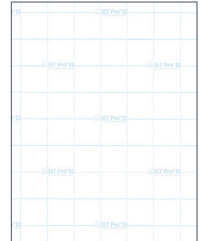

3G JET OPAQUE® and **JET OPAQUE® II** Heat Transfer Papers are printable by most desktop and roll fed inkjet printers and is easy to use for transferring inkjet photo-quality images or other graphics to dark colored materials, offering a soft, supple transferred image that is vibrant and durable – and will withstand many laundry cycles.

- Image can be plot cut or trimmed
- Image should be printed **RIGHT-READING**


HEAT
RIGHT-READING

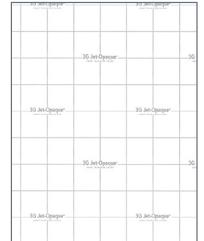

JET-PRO® Active Wear Heat Transfer Paper is designed for the heat transfer of photos and images using ink jet printers to light colored synthetic garments including stretchy performance fabrics. On synthetic fibers this product has superior wash fastness and almost no hand.

- Image should be printed in **REVERSE**

HEAT
REVERSE/MIRRORED

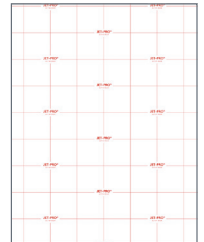

**QUALITY DIGITAL
SOLUTIONS**

#12, 5815 - 40 Street S.E.
Calgary, Alberta, T2C 2H6



403.262.6915 888.235.2838
qualitydigitalsolutions.ca



MADE IN USA

NEENAH COLDENHOVE Brands for Inkjet Printers	Product ID	Natural & 50/50 Fabric	Poly Fabric	Hard Surface	Mesh Screen 85-230	Works well with Photos	Certified for HP Indigo Presses	Prepress*	Peel Temperature				Cover with Parchment	Repress and Stretch	Weedable
									Hot	Warm	Cold	Hand Iron			
JET-PRO® SS (Soft Stretch)	9811P0	✓	★	★		✓		✓	✓	✓	✓	✓	•	•	
3G JET OPAQUE®	9838P0	✓	★	★		✓		✓			✓	✓	✓		★
JET OPAQUE® II	0000P0	✓	★	★		✓		✓			✓	✓	✓		★
JET-PRO® ACTIVE WEAR	9830P0		✓			✓		✓	✓			✓			

✓ Yes [✓ If, • Then] ★ With special settings, dictated by the design

*Prepress to remove wrinkles and moisture.

	JET-PRO® SS	JET OPAQUE®	JET-PRO® Active Wear
PRINTING:	<ol style="list-style-type: none"> 1. Print the image in reverse or mirrored format. 2. Trim away the unprinted areas of the transfer if desired. 	<ol style="list-style-type: none"> 1. Print image on coated side of paper right reading (do not mirror the image). 2. Trim away the unprinted areas of the transfer if desired. 	<ol style="list-style-type: none"> 1. Mirror the image. Load the paper so the image will appear on the coated side of the paper. 2. Trim away the unprinted areas of the transfer if desired.
PRE-TRANSFERRING:	Prepare the garment/fabric by ensuring the surface is clean, dry, and wrinkle free using a lint brush and your heat press.		
TRANSFERRING:	<ol style="list-style-type: none"> 1. Place the transfer on top of the garment with the image side touching the substrate (backing paper is facing you). 2. Press 30 seconds at 375°F/190°C using medium/heavy pressure (30 psi/3 to 5 bar). 3. Let paper cool up to 1 minute to avoid burning fingers. 4. Peel the paper while still hot in a smooth even motion. (Paper may be peeled at any temperature, depending on which end "feel" results are preferred - See the chart on Page 1). 5. For greatest softness, quickly stretch the fabric in all directions while still hot. If you used the cold peel method, quickly repress the parchment covered image and stretch while still hot. 	<ol style="list-style-type: none"> 1. Bend a corner to remove the backing paper from the printed image. 2. Place the Heat Transfer Paper on the top of the garment with the image facing up (right reading to you). 3. Completely cover the image with one sheet of parchment paper. 4. Press: 30 seconds at 350°F/177°C using medium pressure (30 to 45 psi/2 to 3 bar). 5. Once cold, peel away ironing sheet in a smooth even motion. 	<ol style="list-style-type: none"> 1. Place the transfer on top of the garment with the image side down. 2. Press: 20 to 25 seconds at 375°F/190°C using heavy pressure. Lower temperatures and times may result in better transfers on some fabrics. 3. Remove paper while still hot. This fabric will be very hot please use caution. (Product is not recommended for 100% cotton.)
WASHING:	Turn garment inside out and wash in cold water using a mild detergent. Do not use bleach. Dry on low-heat setting. If you intend to iron the transferred area, ensure that the image is covered with parchment paper before ironing.		
STORAGE AND HANDLING:	Store Heat Transfer Paper in a cool, dry area and do not remove from carton or poly bag until you are ready to use.		

IMPORTANT: Printers and heat presses vary in accuracy. We have tested our products with numerous printers and presses with excellent results. Nonetheless, we recommend that you test the paper in your equipment to ensure the best results. Neenah's maximum obligation shall be to replace any paper that has proven to be defective.



For more information about Neenah Paper Heat Transfer Papers:
 North America: 800.344.5287 | Outside North America: 906.387.2700
neenahheat.com | neenah.heat@neenah.com | @neenahheat

